# **CERTIS B2: PDT-B2 SERIES**

# **DIRECT THERMAL BAR CODE PRINTER**

# USER'S MANUAL





# **Contents**

Copyright Declaration	1
1. Introduction	2
1.1 Product Introduction	2
1.2 Compliances	2
2. Operations Overview	3
2.1 Unpacking and Inspection	3
2.2 Printer Overview	4
2.2.1 Front View	4
2.2.2 Interior View	5
2.2.3 Rear View	6
3. Setup	7
3.1 Setting Up the Printer	7
3.2 Loading the Media	7
3.2.1 Loading the Wristband Roll	<b>7</b>
3.3 Diagnostic Tool	10
3.3.1 Start the Diagnostic Tool	10
3.3.2 Printer Function (Calibrate sensor, Ethernet setup,)	11
3.4 Setting Ethernet by Diagnostic Utility	12
3.4.1 Using USB interface to setup Ethernet interface	12
3.4.2 Using Ethernet interface to setup Ethernet interface	13
3.5 Install MicroSD Memory Card	15
3.6 Mount the Printer on the Wall	16
4. LED and Button Functions	17
4.1 LED Indicator	17
4.2 Regular Button Function	17
4.3 Power on Utilities	17
4.3.1 Black Mark Sensor Calibration	18
4.3.2 Black Mark Calibration, Self-test and Dump Mode	19
4.3.3 Printer Initialization	22
4.3.4 Set and Calibrate Black Mark Sensor as Media Sensor	23
4.3.5 Set and Calibrate Gap Sensor as Media Sensor	23
4.3.6 Skip AUTO.BAS	24
5. Troubleshooting	25
5.1 LED Status	25
5.2 Print Problem	26
5.3 LCD display	
6. Maintenance	

# 1. Introduction

## 1.1 Product Introduction

Thank you for purchasing PDC bar code printer. Although the printer has a small footprint, it delivers reliable, superior performance.

This printer provides direct thermal printing at user selectable speed of: 2.0, 3.0, 4.0 or 5.0 ips. It accepts roll feed with black mark. All common bar codes formats are available. Fonts and bar codes can be printed in 4 directions, 8 different alphanumeric bitmap fonts and built-in scalable font capability. You will enjoy trouble free, high throughput for printing wristbands with this printer.

## 1.2 Compliances

CE Class B:

EN55022: 1998+A1: 2000+A2: 2003

EN55024: 1998+A1: 2001+A2: 2003 IEC 61000-4 Series

EN61000-3-2: 2006 & EN61000-3-3: 1995+A1: 2001

FCC Part 15, Class B UL, CUL: UL60950-1

C-Tick:

CFR 47, Part 15/CISPR 22 3rd Edition: 1997, Class B

ANSI C63.4: 2003 Canadian ICES-003

TÜV/Safety: EN60950-1 / IEC 60950-1

#### **CAUTION**

- 1. HAZARDOUS MOVING PARTS IN CUTTER MODULE. KEEP FINGER AND OTHER BODY PARTS AWAY.
- 2. THE MAIN BOARD INCLUDES REAL TIME CLOCK FEATURE HAS LITHIUM BATTERY CR2032 INSTALLED. RISK OF EXPLOSION IF BATTERY IS REPLACED BY AN INCORRECT TYPE.
- 3. DISPOSE OF USED BATTERIES ACCORDING TO THE MANUFACTURER INSTRUCTIONS.

#### Note:

The maximum printing ratio per dot line is 15% for this printer. To print the full web black line, the maximum black line height is limited to 40 dots, which is 5mm for 203 DPI resolution printer.

# 2. Operations Overview

# 2.1 Unpacking and Inspection

This printer has been specially packaged to withstand damage during shipping. Please carefully inspect the packaging and printer upon receiving the bar code printer. Please retain the packaging materials in case you need to reship the printer.

Unpacking the printer, the following items are included in the carton.


- One printer unit
- One USB drive
- One power cord
- One auto switching power supply
- One USB interface cable



If any parts are missing, please contact the Customer Service.

## 2.2 Printer Overview

#### 2.2.1 Front View

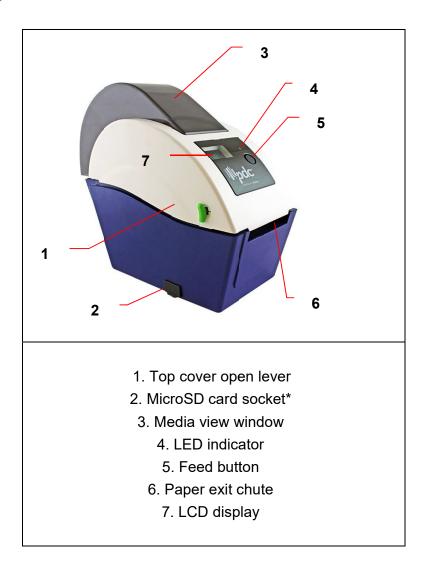


<sup>\*</sup> Recommended MicroSD card specification.

SD card spec	SD card capacity	Approved SD card manufacturer
V1.0, V1.1	MicroSD 128 MB	Transcend, Panasonic
V1.0, V1.1	MicroSD 256 MB	Transcend, Panasonic
V1.0, V1.1	MicroSD 512 MB	Transcend, Panasonic
V1.0, V1.1	MicroSD 1 GB	Transcend, Panasonic
V2.0 SDHC CLASS 6	MicroSD 4 GB	Transcend


<sup>-</sup> The DOS FAT file system is supported for the SD card.

<sup>-</sup> Folders/files stored in the SD card should be in the 8.3 filename format

#### 2.2.2 Interior View

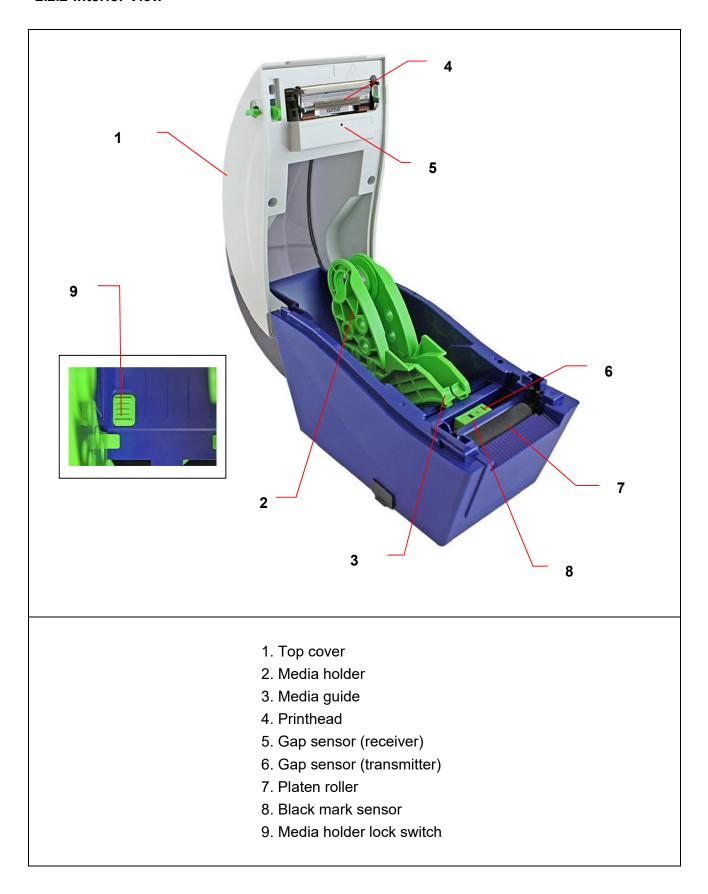

#### 2.2.3 Rear View

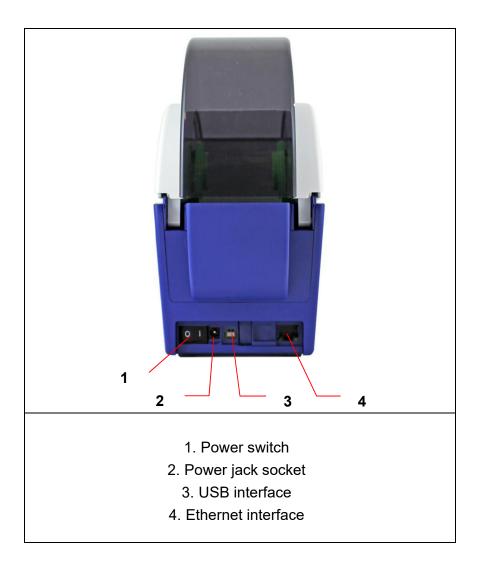

#### Note:

The interface picture here is for reference only. Please refer to the product specification for the interfaces availability.

# 3. Setup

# 3.1 Setting Up the Printer

- 1. Place the printer on a flat, secure surface.
- 2. Make sure the power switch is set to "off".
- 3. Connect the printer to the computer with the provided USB cable.
- 4. Plug the power cord into the AC power cord socket at the rear of the printer, and then plug the power cord into a properly grounded power outlet.

Note: Please switch OFF printer power switch prior to plug in the power cord to printer power jack.

## 3.2 Loading the Wristband Roll Media

#### 3.2.1 Loading the Media


1. Open the printer top cover by pulling the tabs located on each side towards the front of the printer, and then lift the top cover to the maximum open angle.




3. Separate the media holders to the wristband roll width.



4. Place the roll between the holders and close them onto the core.

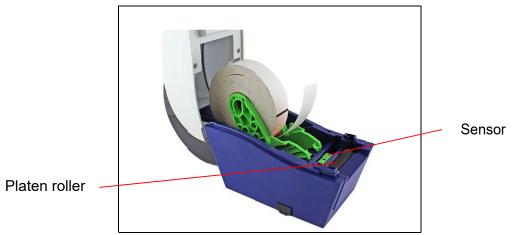


5. Place the paper, printing side face up, through the media guides, media sensor and place the wristband leading edge onto the platen roller.

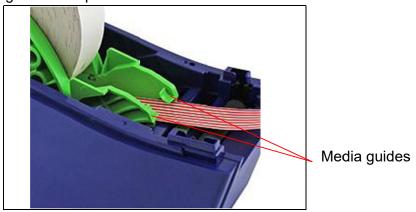

6. Close the top cover gently and make sure the cover latches securely.




7. Use "Diagnostic Tool" to set the media sensor type and calibrate the selected sensor. (Start the "Diagnostic tool" → Select the "Printer Configuration" tab → Click the "Calibrate Sensor" button)

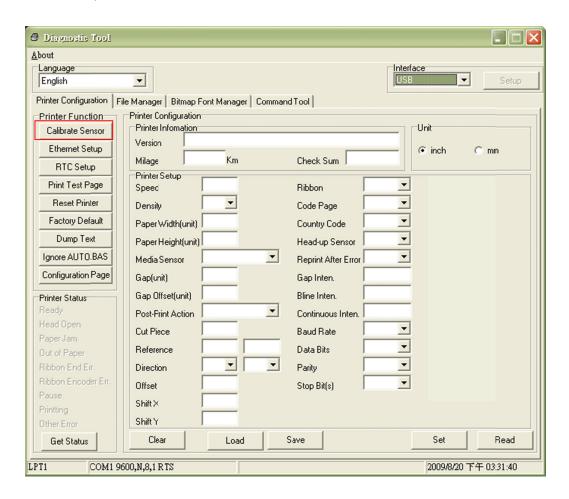

#### Note:

\* Please calibrate the black mark sensor when changing media.

#### Loading path for wristbands

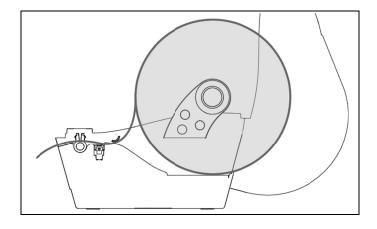


#### 3.3 Diagnostic Tool

The Diagnostic Utility is enclosed in the USB stick Utilities directory. The Diagnostic Utility is a toolbox that allows users to explore the printer's settings and status; change printer settings; download graphics, fonts, and firmware; create printer bitmap fonts; and to send additional commands to the printer. Using this convenient tool, you can explore the printer status and settings and troubleshoot the printer.

Note: This utility works with printer firmware V6.00 and later versions.

### 3.3.1 Start the Diagnostic Tool

- 1. Double click on the Diagnostic tool icon Diagnostic tool icon to start the software.
- 2. There are four features (Printer Configuration, File Manager, Bitmap Font Manager, Command Tool) included in the Diagnostic utility.

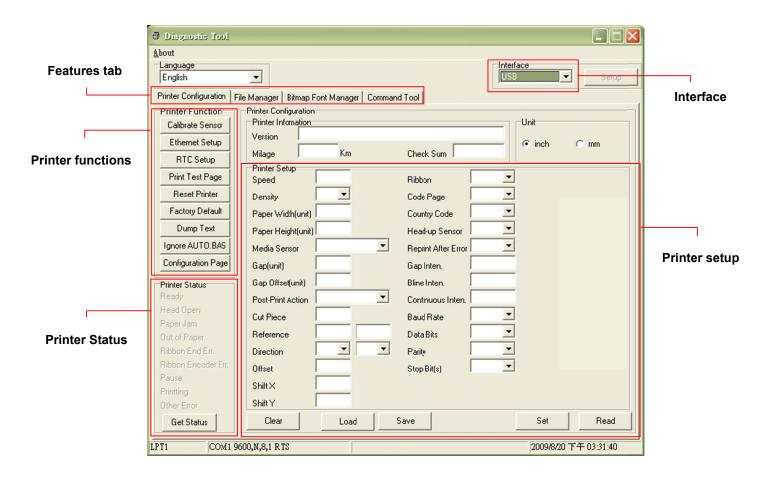

## 3.3.2 Printer Function (Calibrate sensor, Ethernet setup, RTC setup......)

- 1. Select the PC interface connected with bar code printer.
- 2. Click the "Function" button to setting.
- 3. The detail functions in the Printer Function Group are listed as below.

	Function	Description
Printer Function  Calibrate Sensor	Calibrate Sensor	Calibrate the sensor specified in the Printer Setup group media sensor field
Ethernet Setup	Ethernet Setup	Setup the IP address, subnet mask, gateway for the on board Ethernet (Please refer to next section)
Print Test Page	RTC Time	Synchronize printer Real Time Clock with PC
Reset Printer	Print Test Page	Print a test page
Factory Default	Reset Printer	Reboot printer
Dump Text	Factory Default	Initialize the printer and restore the settings to factory default.
Ignore AUTO.BAS	Dump Text	To activate the printer dump mode.
Configuration Page	Ignore AUTO.BAS	Ignore the downloaded AUTO.BAS program
	Configuration Page	Print printer configuration

#### Note:

For more information about Diagnostic Tool, please refer to the diagnostic utility quick start guide in the CD disk \ Utilities directory.

## 3.4 Setting Ethernet by Diagnostic Utility

The Diagnostic Utility is enclosed in USB Stick \Utilities directory. Users can use Diagnostic Tool to setup the Ethernet by USB and Ethernet interfaces. The following contents will instruct users how to configure the Ethernet by these interfaces.

#### 3.4.1 Using USB interface to setup Ethernet interface


- 1. Connect the USB cable between the computer and the printer.
- 2. Turn on the printer power.
- 3. Start the Diagnostic Utility by double clicking on the DiagToolexe icon.

Note: This utility works with printer firmware V6.00 and later versions.

4. The Diagnostic Utility default interface setting is USB interface. If USB interface is connected with printer, no other settings need to be changed in the interfacefield.



5. Click on the "Ethernet Setup" button from "Printer Function" group in Printer Configuration tab to setup the IP address, subnet mask and gateway for the on board Ethernet.

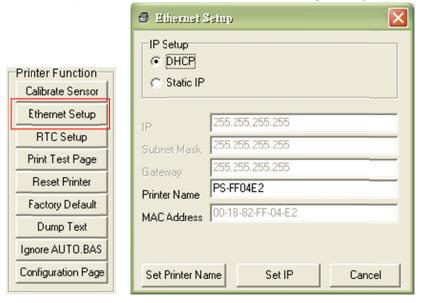


#### 3.4.2 Using Ethernet interface to setup Ethernet interface

- 1. Connect the computer and the printer to the LAN.
- 2. Turn on the printer power.
- 3. Start the Diagnostic Utility by double clicks on the 

  DiagToolexe icon.

#### Note: This utility works with printer firmware V6.00 and later versions.

4. Select "Ethernet" as the interface then click on the "Setup" button to setup the IPaddress, subnet mask and gateway for the on board Ethernet.

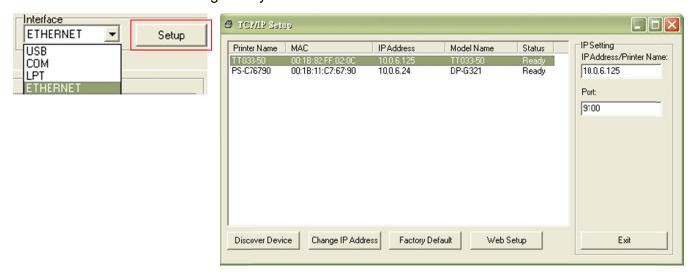

- 5. Click the "Discover Device" button to explore the printers that exist on the network.
- 6. Select the printer in the left side of listed printers, the correspondent IP address will be shown in the right side "IP address/Printer Name" field.
- 7. Click "Change IP Address" to configure the IP address obtained by DHCP or static.



The default IP address is obtained by DHCP. To change the setting to static IP address, click "Static IP" radio button then enter the IP address, subnet mask and gateway. Click "Set IP" to take effect the settings.

Users can also change the "Printer Name" by another model name in this fields then click "Set Printer Name" to take effect this change.

# Note: After clicking the "Set Printer Name" or "Set IP" button, printer will reset to take effect the settings.

8. Click "Exit" button to exit the Ethernet interface setup and go back to Diagnostic Tool main screen.

#### Factory Default button

This function will reset the IP, subnet mask; gateway parameters obtained by DHCP and reset the printer name.

#### Web setup button

Except to use the Diagnostic Utility to setup the printer, you can also explore and configure the printer settings and status or update the firmware with the IE or Firefox web browser. This feature provides a user friendly setup interface and the capability to manage the printer remotely over a network.

# 3.5 Install MicroSD Memory Card

1. Open the SD memory card cover.



2. Insert the MicroSD\* card into the socket.



3. Close the memory card cover.



\* Recommended SD card specification.


SD card capacity	Approved SD card manufacturer
MicroSD 128 MB	Transcend, Panasonic
MicroSD 256 MB	Transcend, Panasonic
MicroSD 512 MB	Transcend, Panasonic
MicroSD 1 GB	Transcend, Panasonic
MicroSD 4 GB	Transcend
	MicroSD 256 MB MicroSD 512 MB

<sup>-</sup> The DOS FAT file system is supported for the SD card.

<sup>-</sup> Folders/files stored in the SD card should be in the 8.3 filename format

# 3.6 Mount the Printer on the Wall

There are three holes in the bottom of printer. Printer can be mounted on the wall by the 3.0mm~3.5mm screw head screws.

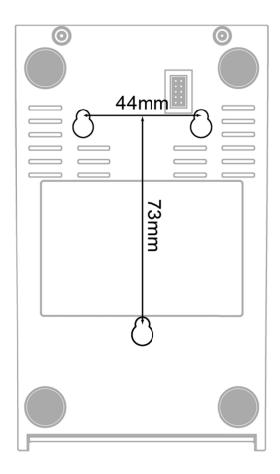

Note: Please hang properly to avoid fall down

## 4. LED and Button Functions

This printer has one button and one three-color LED indicator. By indicating the LED with different color and pressing the button, printer can feed wristbands, pause the printing job, select and calibrate the media sensor, print printer self-test report, reset printer to defaults (initialization). Please refer to the button operation below for different functions.

#### 4.1 LED Indicator

LED Color	Description
Green/ Solid	This illuminates that the power is on and the device is ready to
	use.
Green/ Flash	This illuminates that the system is downloading data from PC to
Gleen/ Flash	memory or the printer is paused.
Amber	This illuminates that the system is clearing data from printer.
Red / Solid	This illuminates printer head open, cutter error.
Red / Flash	This illuminates a printing error, such as head open, paper empty, paper jam or memory error etc.

## 4.2 Regular Button Function

#### 1. Feed wristbands

When the printer is ready, press the button to feed one wristband to the beginning of next wristband.

#### 2. Pause the printing job

When the printer is printing, press the button to pause a printing job. When the printer is paused, the LED will be green blinking. Press the button again to continue the printing job.

#### 4.3 Power on Utilities

There are six power-on utilities to set up and test printer hardware. These utilities are activated by pressing FEED button then turning on the printer power simultaneously and release the button at different color of LED.

Please follow the steps below for different power-on utilities.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED indicates with different color for different functions.

Power on utilities	The LE	D color v	will be ch	anged a	s following p	attern:	
LED color	Amber	Red	Amber	Green	Green/Amber	Red/Amber	Solid green
Functions		(5 blinks)	(5 blinks)	(5 blinks)	(5 blinks)	(5 blinks)	
1. Black mark sensor calibration		Release					
2. Black mark sensor calibration,			Release				
Self-test and enter dump mode							
3. Printer initialization				Release			
4. Set black mark sensor as media					Release		
sensor and calibrate the black mark							
sensor							
5. Set gap sensor as media sensor and						Release	
calibrate the gap sensor							
6. Skip AUTO.BAS							Release

#### 4.3.1 Black Mark Sensor Calibration

Black mark sensor sensitivity should be calibrated at the following conditions:

- 1. A brand new printer
- 2. Change wristband stock.
- 3. Printer initialization.

Please follow the steps below to calibrate the Black mark sensor.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3 Release the button when LED becomes **red** and blinking. (Any red will do during the 5 blinks).
- It will calibrate the Black mark sensor sensitivity.
- The LED color will be changed as following order:
   Amber → red (5 blinks) → amber (5 blinks) → green (5 blinks) → green/amber (5 blinks)
   → red/amber (5 blinks) → solid green

#### Note:

- 1. Sensor calibration can be done by Diagnostic Tool or by power on utility. Please refer to "3.3 Diagnostic Tool" Section for more information.
- 2. Please select black mark sensor type prior to calibrate the sensor.

#### 4.3.2 Black Mark Calibration, Self-test and Dump Mode

While calibrate the black mark sensor, printer will measure the wristband length, print the internal configuration (self-test) on wristband and then enter the dump mode. To calibrate black mark sensor, depends on the sensor setting in the last print job.

Please follow the steps below to calibrate the sensor.


- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED becomes **amber** and blinking. (Any amber will do during the 5 blinks)
- The LED color will be changed as following order.
  Amber → red (5 blinks) → amber (5 blinks) → green (5 blinks) → green/amber (5 blinks)
  → red/amber (5 blinks) → solid green
- 4. It calibrates the sensor and measures the wristband length and prints internal settings then enter the dump mode.


#### Note:

- 1. Sensor calibration can be done by Diagnostic Tool or by power on utility. Please refer to "3.3 Diagnostic Tool" Section for more information.
- 2. Please select black mark sensor type prior to calibrate the sensor.

#### Self-test

Printer will print the printer configuration after black mark sensor calibration. Self-test printout can be used to check if there is any dot damage on the heater element, printer configurations and available memory space.

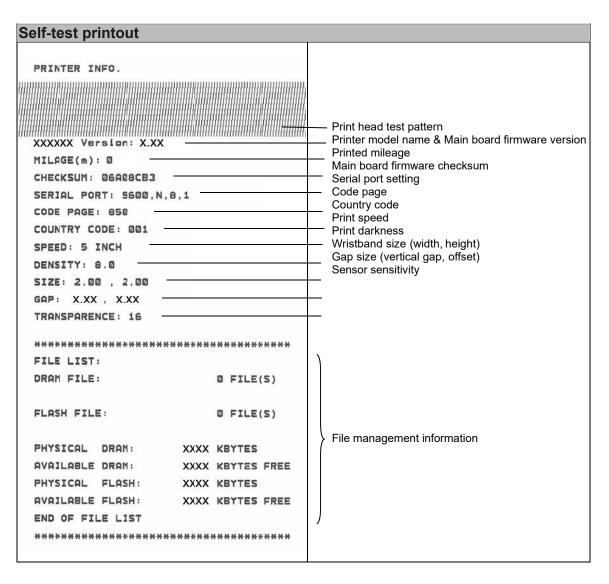


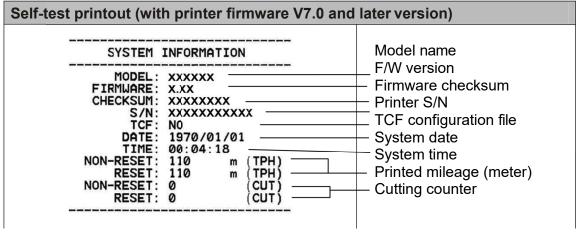

PRINTING SETTING  SPEED: 5 IPS  DENSITY: 8.0  WIDTH: 4.00 INCH  HEIGHT: 4.00 INCH  GAP: 0.00 INCH  INTENSION: 5  CODEPAGE: 850  COUNTRY: 001	Print speed (inch/sec) Print darkness Wristband size (inch) Gap distance (inch) Gap/black mark sensor intension Code page Country code
Z SETTING  DARKNESS: 16.0 SPEED: 4 IPS WIDTH: 4.00 INCH TILDE: 7EH (~)  CARET: 5EH (~) DELIMITER: 2CH (,) POWER UP: NO MOTION HEAD CLOSE: NO MOTION	ZPL setting information  — Print darkness  — Print speed (inch/sec)  — Wristband size  — Control prefix  — Format prefix  — Delimiter prefix  — Printer power up motion  — Printer head close motion  Note:  ZPL is emulating for Zebra® language.
RS232 SETTING  BAUD: 9600 PARITY: NONE DATA BIT: 8 STOP BIT: 1	RS232 serial port configuration
PHYSICAL XXXX KBYTES AVAILABLE XXXX KBYTES  FLASH FILE (0 FILES)  PHYSICAL XXXX KBYTES  AVAILABLE XXXX KBYTES	Numbers of download files  Total & available memory space
	Print head check pattern

#### Dump mode

Printer will enter dump mode after printing printer configuration. In the dump mode, all characters will be printed in 2 columns as following. The left side characters are received from your system and right side data are the corresponding hexadecimal value of the characters. It allows users or engineers to verify and debug the program.

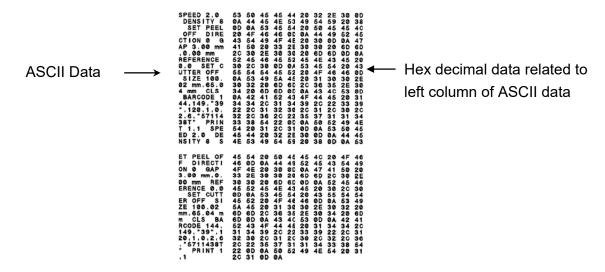

#### Note:

- 1. Dump mode requires 2" wide paper width.
- 2. Turn off / on the power to resume printer for normal printing.
- 3. Press FEED button to back to the previous menu.

#### 4.3.3 Printer Initialization

Printer initialization is used to clear DRAM and restore printer settings to defaults. Printer initialization is activated by the following procedures.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED turns **green** after 5 amber blinks. (Any green will do during the 5 blinks).
- The LED color will be changed as following:
  Amber → red (5 blinks) → amber (5 blinks) → green (5 blinks) → green/amber (5 blinks)
  → red/amber (5 blinks) → solid green

Printer configuration will be restore to defaults as below after initialization.

Parameter	Default setting
Speed	127 mm/sec (5 ips) (203DPI)
Density	8
Wristband Width	2" (50.8 mm)
Wristband Height	4" (101.6 mm)
Sensor Type	Gap sensor
Gap Setting	0.12" (3.0 mm)
Print Direction	0
Reference Point	0,0 (upper left corner)
Offset	0
Tear Mode	On
Peel off Mode	Off
Cutter Mode	Off
Serial Port Settings	9600 bps, none parity, 8 data bits, 1 stop bit
Code Page	850
Country Code	001
Clear Flash Memory	No
IP Address	DHCP

#### 4.3.4 Set Black Mark Sensor as Media Sensor and Calibrate the Black Mark Sensor

Please follow the steps as below.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED turns **green/amber** after 5 green blinks. (Any green/amber will do during the 5 blinks).
- The LED color will be changed as following:
   Amber → red (5 blinks) → amber (5 blinks) → green (5 blinks) → green/amber (5 blinks)
   → red/amber (5 blinks) → solid green

#### 4.3.5 Set Gap Sensor as Media Sensor and Calibrate the Gap Sensor

Please follow the steps as below.

- 1. Turn off the power switch.
- 2. Hold on the button then turn on the power switch.
- 3. Release the button when LED turns **red/amber** after 5 green/amber blinks. (Any red/amber will do during the 5 blinks).

The LED color will be changed as following:
 Amber → red (5 blinks) → amber (5 blinks) → green (5 blinks) → green/amber (5 blinks)
 → red/amber (5 blinks) → solid green

#### 4.3.6 Skip AUTO.BAS

TSPL2 programming language allows user to download an auto execution file to flash memory. Printer will run the AUTO.BAS program immediately when turning on printer power. The AUTO.BAS program can be interrupted without running the program by the power-on utility.

Please follow the procedures below to skip an AUTO.BAS program.

- 1. Turn off printer power.
- 2. Press the FEED button and then turn on power.
- 3. Release the FEED button when LED becomes **solid green**.
- The LED color will be changed as following:
   Amber → red (5 blinks) → amber (5 blinks) → green (5 blinks) → green/amber (5 blinks)
   → red/amber (5 blinks) → solid green
- 4. Printer will be interrupted to run the AUTO.BAS program.

# 5. Troubleshooting

The following guide lists the most common problems that may be encountered when operating this bar code printer. If the printer still does not function after all suggested solutions have been invoked, please contact the Customer Service Department of your purchased reseller or distributor for assistance.

#### 5.1 LED Status

This section lists the common problems that according to the LED status and other problems you may encounter when operating the printer. Also, it provides solutions.

<b>LED Status</b>	Printer	Possible Cause	Recovery Procedure
/ Color	Status		
OFF	No response	No power	* Turn on the power switch.
			* Check if the green LED is lit on power supply. If
			it is not lit on, power supply is broken.
			* Check both power connections from the power
			cord to the power supply and from the power
			supply to the printer power jack if they are
			connected securely.
Solid Green	ON	The printer is ready to	* No action necessary.
		use	
Green with	Pause	The printer is paused	* Press the FEED button to resume for printing.
blinking			
Red with	Error	The out of wristband	1. Out of wristband
blinking		or the printer setting is	* Load a roll of wristband and follow the
		not correct	instructions in loading the media then press the
			FEED button to resume for printing.
			2. Printer setting is not correct
			* Initialize the printer by instructions in "Power on
			Utility" or "Diagnostic Tool".

#### Note:

Printer status can be easily shown on the Diagnostic Tool. For more information about the Diagnostic Tool, please refer to the instruction in the USB Stick.

## **5.2 Print Problem**

Problem	Possible Cause	Recovery Procedure
	Check if interface cable is well	Re-connect cable to interface.
	connected to the interface connector.	
	The serial port cable pin configuration is	Please replace the cable with pin to pin
	not pin to pin connected.	connected.
Not Printing	The serial port setting is not consistent	Please reset the serial port setting.
Not Finding	between host and printer.	
	The port specified in the Windows driver	Select the correct printer port in the
	is not correct.	driver.
	The Ethernet IP, subnet mask, gateway	Configure the IP, subnet mask and
	is not configured properly.	gateway.
No print on the	Wristband loaded not correctly.	Follow the instructions in loading the
wristband	Whistband loaded not correctly.	media.
Continuous feeding	The printer setting may go wrong.	Please do the initialization and black
wristbands	The printer setting may go wrong.	mark calibration.
	Black mark sensor sensitivity is not set	Calibrate the black mark sensor.
	properly (sensor sensitivity is not	
	enough)	
Paper Jam	Make sure wristband size is set properly.	Set wristband size exactly as installed paper in the labeling software or program.
	Wristbands may be stuck inside the	Remove the stuck wristband.
	printer mechanism near the sensor area.	
	Top cover is not closed properly.	Close the top cover completely and make sure the right side and left side levers are latched properly.
	Wrong power supply is connected with printer.	Check if 24V DC output is supplied by the power supply.
	Check if supply is loaded correctly.	Reload the supply.
Poor Print Quality	Check if dust or adhesives are	Clean the print head.
	accumulated on the print head.	
	Check if print density is set properly.	Adjust the print density and print speed.
	Check print head test pattern if head	Run printer self-test and check the print head test pattern if there is dot missing
	element is damaged.	in the pattern.

# 5.3 LCD display

This section lists the LCD display messages that you may encounter when operating the printer. Also, it provides solutions.

Messages	Possible Cause	Recovery Procedure	
Head Open	* The printer top cover is open.	* Please close the top cover.	
No Paper	* Running out of wristband. * The wristband is installed incorrectly. * Black mark sensor is not calibrated.	* Supply a new wristband roll.  * Please refer to the steps in user's manual to reinstall the wristband roll.  * Calibrate the black mark sensor.	
Paper Jam	* Black mark sensor is not set properly.  * Make sure wristband size is set properly.  * Wristbands may be stuck inside the printer mechanism.	* Calibrate the black mark sensor. * Set wristband size correctly.	
Out of Mem	* The space of FLASH/DRAM or MicroSD card is full.	* Delete unused files in the FLASH/DRAM or MicroSD card.	
Take Label	* Peel function is enabled. Waiting user to take wristband away to print the next wristband.	* Please take the wristband away to print the next wristband if peeler module is installed.  * If peeler module is installed and wristband is been taken away, but the message remains. Please check if the peeler module connector is connected to main board properly.  * If peeler module is not installed, please disable the peeler function.	
Cutter Error	* Cutter jam.  * There is no cutter installed on the printer.  * Cutter or cutter driver circuit board is damaged.	* Remove the jammed wristband. * Make sure the media thickness is equal or less than 0.19mm. * Replace the cutter or cutter driver circuit board.	

# 6. Maintenance

This session presents the clean tools and methods to maintain your printer.

- 1. Please use one of following material to clean the printer.
- Cotton swab (Head cleaner pen)
- Lint-free cloth
- Vacuum / Blower brush
- 100% ethanol
- 2. The cleaning process is described as following:

Printer Part	Method	Interval		
	1. Always turn off the printer before cleaning	Clean the print head when changing a		
	the print head.	new wristband roll		
	2. Allow the print head to cool for a minimum			
	of one minute.			
	3. Use a cotton swab and 100% ethanol to			
	clean the print head surface.			
		Print Head		
Print Head	Print Head			
	Element			
	0			
		Element		
	Head Classes Res	Element		
	Head Cleaner Pen			
	1. Turn the power off.	Clean the platen roller when changing		
Platen Roller	2. Rotate the platen roller and wipe it	a new wristband roll		
	thoroughly with 100% ethanol and a			
	cotton swab, or lint-free cloth.			
Tear Bar/Peel Bar	Use the lint-free cloth with 100% ethanol to	As needed		
Teal Bai/Feel Bai	wipe it.			
Sensor	Compressed air or vacuum	Monthly		
Exterior	Wipe it with water-dampened cloth	As needed		
Interior	Brush or vacuum	As needed		

#### Note:

- Do not touch printer head by hand. If you touch it careless, please use ethanol to clean it.
- Please use 100% Ethanol. DO NOT use medical alcohol, which may damage the printer head.
- Regularly clean the print head and supply sensors once change a new media to keep printer performance and extend printer life.
- The maximum printing ratio per dot line is 15% for this printer. To print the full web black line, the maximum black line height is limited to 40 dots, which is 5mm for 203 DPI resolution printer.